

Release Note LS-US2 v1.2.1.16

New Features

N/A

Issue Fixed & Modification

V1.2.1.16

- Fixed “When two webcams with the same USB serial ID were used as video inputs, the Station showed the same webcam source after rebooting.”
- Fixed “Part of the RTSP stream image appeared pixelated.”
- Fixed “[Random] Changing video source settings could cause the online director preview not to display.”
- Fixed “[Random] Switching USB audio settings between ‘None’ and any USB audio device could cause a system crash.”
- Fixed “The system was unable to receive a network camera or stream source with more than three slashes in its URL.”
- Removed the redundant line break in the middle of the NDI stream name.
- Fixed “Service logging stopped after an incorrect iCal URL was applied in the scheduler settings.”
- Fixed “The ‘Record to USB’ option didn’t respond correctly when recording was enabled or disabled.”
- Fixed “The ‘Add theme’ button didn’t disappear when there were already 10 themes on the list.”
- Modified HID behavior so that the cursor automatically hides after being idle for 2 seconds.
- Modified the web preview mechanism so that LS-US2 no longer requires an internet connection for web preview.
- Added an on/off switch for the GUI menu bar.
- Added a switch to hide/show the playback (export) button on the GUI menu.
- Support USB audio devices with 24-bit depth.
- Fixed “When upload set to Google Drive with non-English characters set in folder name, Stations could create multiple folders falsely.”
- Hard fix for “When scheduling recordings using Kaltura, Stations did not start and stop recording according to the event times.”
- This issue was found in early April 2024 (around Apr. 9th, 2024) and was fixed in Kaltura SaaS version Tucana-20.11.0, tested on May 20th, 2024.

Limitation & Known Issues

- The audio and video in the web preview are not synchronized.
 - There is no volume control for DisplayPort output.
 - Even when the audio loopthrough is disabled, the USB audio source still exists in the local output.
 - The audio shift is not always applied.
 - There are UI issues in the theme editor, making it difficult to adjust the preferred layout every time.
-
- **Notice: During the firmware update progress, please always keep the power on to prevent permanent system unstable or damage.**
 - **Please reset after updating LS-US2 from version v1.1.x.x to v1.2.x.x.**
 - **The configuration file exported from v1.1.x.x may not be compatible with v1.2.x.x. It is recommended to take noted of all settings before upgrading the firmware.**